Industrial pressure controller Model CPC4000



WIKA data sheet CT 27.40

Applications

- Oil and gas industry
- Industry (laboratory, workshop and production)
- Transmitter and pressure gauge manufacturers
- Calibration service companies and service industry

Special features

- Pressure ranges: -1 ... 210 bar (-15 ... 3,045 psi)
- Control speed 10 s
- Control stability < 0.005 % FS
- Accuracy down to 0.02 % IS (IntelliScale)
- Precision 0.008% FS



Industrial pressure controller, model CPC4000

Description

Design

The model CPC4000 industrial pressure controller offers a broad pressure range from -1 ... 210 bar (-15 ... 3,045 psi). This instrument is available as a desktop or as a 19" rack-mounting kit. It can have up to two reference pressure transducers and an optional barometer for displaying barometric pressure or can be used to emulate gauge or absolute pressure.

Application

Since the controller offers an accuracy of up to 0.02 % IS-50, and controls pressure with a high stability, it is particularly suited as a production tool for transmitter manufacturing, a calibration and maintenance tool for pressure measuring instruments or as a factory/working standard for the calibration of all types of pressure measuring instruments. The leak test and burst test applications allow CPC4000 to be used as a pressure line testing equipment. The optional automatic contamination prevention system makes the CPC4000 an ideal solution in oil and gas plants.

Functionality

Maximum ease-of-use is achieved through the touchscreen and the simple and intuitive menu navigation. In addition, the large number of menu languages add to its operability. The instrument can have up to two internal pressure transducers and the ranges for each reference pressure transducer are determined by the customer within the allowable range.

Depending on the application, the operator can choose between three set-point entry methods:

- Direct entry of the pressure value (set point) which will be controlled via touchscreen keypad.
- Define steps to reach the desired pressure value by either defining fixed pressure increments or a percentage of span value.
- 3) User-defined programmable test sequences.

Software

The WIKA-CAL calibration software enables the convenient calibration of pressure measuring instruments and the generation of test certificates. Additionally, the instrument can also be remotely controlled using the serial command formats, the Mensor standard, SCPI or further optional command sets are available.

Complete test and calibration systems

On request, complete mobile or stationary test systems can be manufactured. There is an IEEE-488.2, RS-232, USB and an Ethernet interface for communication with other instruments, and thus the instrument can be integrated into existing systems.

WIKA data sheet CT 27.40 · PN 0019644001B · 02/2017

Page 1 of 8



Specifications Model CPC4000

Reference pressure transducers model CPR4000			
Pressure range	Standard	Optional	
Accuracy 1)	0.02 % FS ²⁾	0.02 % IS-50 ³⁾	
Gauge pressure	0 0.35 to 0 210 bar (0 5 to 0 3,045 psi)	0 1 to 0 210 bar (0 15 to 0 3,045 psi)	
Bi-directional	-0.17 0.17 to -1 210 bar (-2.5 2.5 to -15 3,045 psi)	-1 10 to -1 210 bar (-15 145 to -15 3,045 psi)	
Absolute pressure 4)	0 1 to 0 211 bar abs. (0 15 to 0 3,060 psi abs.)	0 1 to 0 211 bar abs. (0 15 to 0 3,060 psi abs.)	
Precision 5)	0.008 % FS	0.008 % FS	
Calibration interval	365 days	365 days	
Optional barometric reference			
Function	The barometric reference can be used to switch pressure types ⁶⁾ , absolute <=> gauge. With gauge pressure transducers, the measuring range of the transducers must begin with -1 bar (-15 psi) in order to carry out a complete absolute pressure emulation.		
Measuring range	552 1,172 mbar abs. (8 17 psi abs.)		
Accuracy 1)	0.02 % of reading		
Pressure units	39 and two freely programmable		

- It is defined by the total measurement uncertainty, with the coverage factor (k = 2) and includes the intrinsic performance of the instrument, the measurement uncertainty of the reference instrument, long-term stability, influence of ambient conditions, drift and temperature effects over the compensated range with recommended zero point adjustment every 30 days FS = full span
- 0.02 % IS-50 accuracy. Between 0 ... 50 % of the full scale, the accuracy is 0.02% of half of the full scale value and between 50 ... 100 % of the full scale, the accuracy is 0.02 % of reading.
- The minimum calibrated range of absolute transducer(s) is 600mTorr It is defined as the combined effects of linearity, repeatability and hysteresis throughout the stated compensated temperature range
- For a pressure type emulation, we recommend a native absolute pressure transducer, since the zero point drift can be eliminated through a zero point adjustment.

Base instrument		
Instrument		
Instrument version	Standard: desktop case Option: 19" rack-mounting kit	
Dimensions	See technical drawings	
Weight	approx. 12.7 kg (28 lbs) incl. all internal options	
Warm-up time	approx. 15 min	
Display		
Screen	7.0" color LCD with resistive touchscreen	
Resolution	4 6 digits depending on range and units	
Connections		
Pressure connections	4 ports with 7/16"- 20 F SAE, 1 port with 1/8" F NPT and 1 port with 10-32 UNF female	
Filter elements	The instrument has a 40-micron filters on all pressure ports.	
Pressure port adapters	Standard: without Option: 6 mm tube fitting, 1/4" tube fitting, 1/4" female NPT fittings, 1/8" female NPT fittings or 1/8" female BSP fittings	
Barometer port adapters	Standard: barb fitting Option: 6mm tube fitting, 1/4" tube fitting	
Permissible pressure media	Dry, clean air or nitrogen (ISO 8573-1:2010 class 5.5.4 or better)	
Wetted parts	Aluminum, brass, 316 and 316L stainless steel, Buna N, FKM/FPM, PCTFE, PEEK, PTFE, PPS, glass-filled epoxy, RTV, ceramic, silicone, silicone grease, Urethane	
Overpressure protection	Safety relief valve fixed to reference pressure transducer and adjusted to customized measuring range	
Permissible pressure		
Supply port	110 % FS or 0.69 bar (10 psi), whichever is greater	
Measure/Control port	max. 105 % FS	
Voltage supply		
Power supply	AC 100 240 V, 50/60 Hz	
Power consumption	max. 150 VA	
Permissible ambient conditions		
Storage temperature	-20 70 °C (-4 158 °F)	
Humidity	5 95 % r. h. (relative humidity non-condensing)	



Base instrument			
Compensated temperature range	15 45 °C (59 113 °F)		
Mounting position	horizontal		
Control parameter			
Control stability	< 0.005 % FS of the active range		
Control mode	precision, high speed and custom		
Control time	10 s (regarding a 10 % FS pressure increase in a 50 ml test volume)		
Control range	0 100 % FS		
Minimum control pressure	0.0017 bar (0.025 psi) over exhaust pressure or 0.05% FS whichever is greater		
Overshoots	< 0.3 % FS in high speed control mode (typical <0.1% FS in precision control mode)		
Test volume	50 1,000 ccm		
Communication			
Interface	Standard: Ethernet, IEEE-488, USB, RS-232.		
Command sets	Mensor, WIKA SCPI, others optional		
Response time	approx. 100 ms		
Internal program	up to 24 sequences with up to 99 steps each		


Approvals and certificates	
EC declaration of conformity	
EMC directive 7)	EN 61326-1 emission (group 1, class A) and interference immunity (industrial application)
Low voltage directive	EN 61010-1
Certificate	
Calibration 8)	Standard: A2LA calibration certificate (standard on factory) Option: DKD/DAkkS calibration certificate

⁷⁾ Warning! This is class A equipment for emissions and is intended for use in industrial environments. In other environments, e.g. residential or commercial installations, it can intefere with other equipment under certain conditions. In such circumstances the operator is expected to take the appropriate measures.


8) Calibration in a horizontal position/operating position.

Approvals and certificates, see website

Working ranges of the controller modules

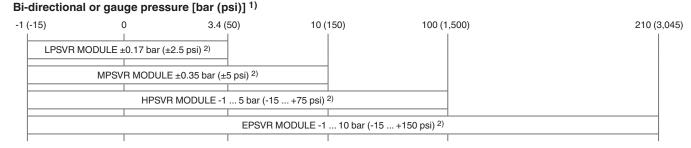

Absolute pressure [bar (psi)] 1)

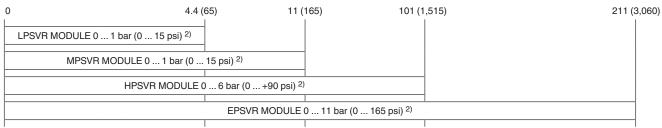

- Mixing of absolute pressure and gauge pressure transducers in a module is not possible.
 Smallest recommendable transducer range


For controlling absolute pressure a vacuum pump connected at the exhaust port is required.



Touchscreen and intuitive operator interface

Shortly after power-up, the standard main screen (see following picture) is displayed. In this menu screen, one can switch between the operating modes using the buttons **MEASURE** (1), **CONTROL** (10) and **VENT** (9). The instrument is a precision pressure controller, whose setup (incl. optional functions) can be easily configured via the touchscreen.

Standard desktop/main screen

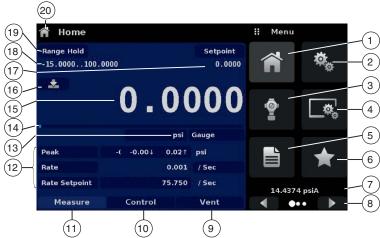

- 1 Home application
- (2) General settings
- 3 Control settings
- 4 Display settings
- 5 Programs
- 6 Favorites
- (7) Barometric pressure reading (optional)
- 8 Menu scroll features forward / back
- 9 VENT

Immediately vents the system, including the test assembly connected to the Measure/Control port, to atmosphere.

10 CONTROL

In control mode the instrument provides a highly accurate pressure at the Measure/Control port of the respective channel in accordance with the desired set point.

11 MEASURE


In measure mode, the pressure present at the Measure/Control port is measured with high accuracy (if you switch directly from **CONTROL** to **MEASURE** mode, the last controlled pressure in the connected test assembly will be maintained/locked).

- (12) Auxiliary displays either peak, rate or alternate units
- (13) Current pressure unit and type
- (14) Optional bar graph
- (15) Current measuring value
- (16) Zero or Tare function
- 17) Entered set point
- (18) Pressure range of the transducers
- (19) Selection of the active transducer or auto-range
- (20) Current application name



Simple instrument configurations

A) General settings of the instrument

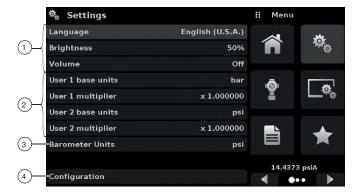


- 1 Instrument language, screen brightness and volume settings
- (2) User-defined measurement units
- (3) Unit for the optional barometer
- Multiple user-specific configurations created and saved for ease of access

B) Control settings of the instrument



- (5) Control behavior between low overshoot and high speed
- 6 The control rate can be entered by the user as a factor of current units/sec
- The stability of the control can be defined by the user by setting the stable window as "% FS" and by setting the stable delay
- (8) The pressure control volume can be adjusted by the user or set to "Auto" for dynamic automatic detection

C) Transducer settings and auxiliary display settings of the instrument

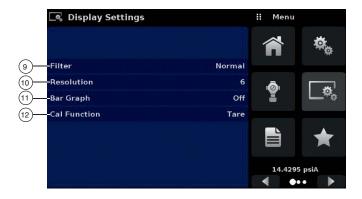


- (9) Electronic filter to smooth the pressure readings
- (10) The resolution of the transducer display can be changed
- (11) Switching the bar graph on or off
- (12) Easy zeroing and tare features




Dimensions in mm (in)

Desktop case

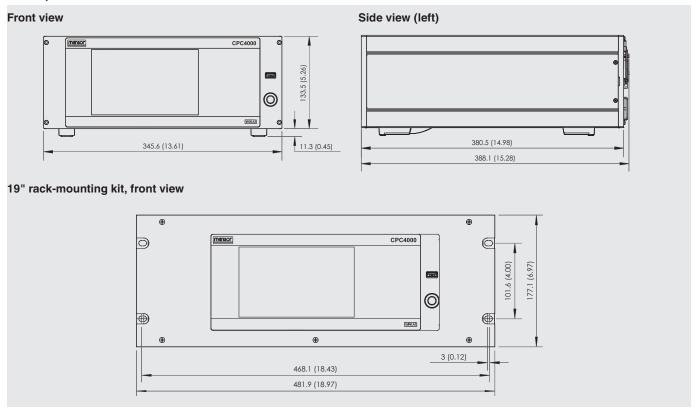

Electrical and pressure connections - rear view

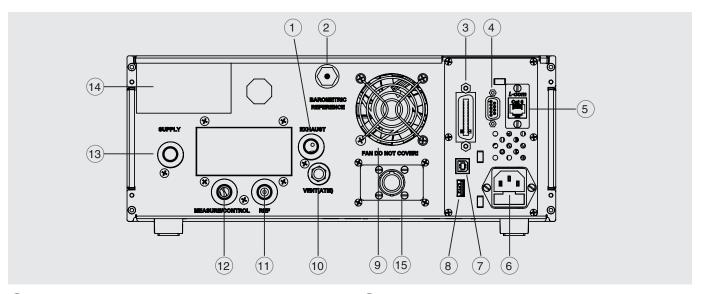

- 1 Exhaust port (7/16-20 UNF)
- 2 Barometric reference port (10-32 UNF)
- (3) IEEE-488 interface
- (4) RS-232 interface
- (5) Ethernet port
- 6 Power supply
- (7) USB interface (instrument) for remote communication
- 8 USB interface (host) for service

- 9 Fan
- (10) Vent (ATM)
- 11) Reference port (7/16-20 UNF)
- (12) Measure/Control port (7/16-20 UNF)
- (13) Supply port (7/16-20 UNF)
- (14) Instrument label
- (15) Automatic CPS connector



8715 Mesa Point Terrace San Diego, CA 92154
Toll Free: 1.866.363.6634 Tel: 1.619.429.4545 Fax: 1.619.374.7012
Email: sales@calright.com http://www.calright.com

WIKA-CAL calibration software

Easy and fast creation of a high-quality calibration certificate

The WIKA-CAL calibration software is used for generating calibration certificates or logger protocols for pressure measuring instruments and is available as a demo version for a cost-free download.

A template helps the user and guides him through the creation process of a document.

In order to switch from the demo version to a full version of the respective template, a USB key with the template has to be purchased.

The pre-installed demo version automatically changes to the selected full version when the USB key is inserted and is available as long as the USB key is connected to the computer.

- Creation of calibration certificates for mechanical and electronic pressure measuring instruments
- Fully automatic calibration with pressure controllers
- Calibration of gauge pressure measuring instruments with absolute pressure references and vice versa
- A calibration assistant guides you through the calibration
- Automatic generation of the calibration steps
- Generation of 3.1 certificates per DIN EN 10204
- Creation of logger protocols
- User-friendly interface
- Languages: German, English, Italian and more due with software updates

For further information see data sheet CT 95.10



Calibration certificates can be created with the Cal-Template and logger protocols can be created with the Log-Template.



Cal Demo

Generation of calibration certificates limited to 2 measuring points, with automatic initiation of pressures via a pressure controller.



Cal Light

Generation of calibration certificates with no limitations on measuring points, without automatic initiation of pressures via a pressure controller.



Cal

Generation of calibration certificates with no limitations on measuring points, with automatic initiation of pressures via a pressure controller.







Log Demo

Creation of data logger test reports, limited to 5 measured values.



Log

Creation of data logger test reports without limiting the measured values.





Scope of delivery

- Industrial pressure controller model CPC4000 (desktop case)
- 1.5 m (5 ft) power cord
- Operating instructions
- A2LA calibration certificate (standard on factory)

Options

- DKD/DAkkS calibration certificate
- Second reference pressure transducer model CPR4000
- Barometric reference
- 19" rack-mounting kit
- Customer-specific system
- Adapters and fittings for pressure connections
- Automatic contamination prevention system

Accessories

- Pressure adapters
- Interface cable
- Coalescing filter
- Block and bleed valve
- Pressure booster
- WIKA-CAL calibration software

